

Reliability Laboratory

Report No.: HE20031/2018

Page: 1 of 5

Date: March 12, 2018

TAIWAN YUASA BATTERY CO., LTD. NO. 11, LANE 227, FUYING RD., HSINCHUANG DISTRICT, NEW TAIPEI CITY, TAIWAN, R.O.C.

The following merchandise was submitted and identified by the vendor as:

Product Description: Battery

Style/ Item No.: NP7-12/ No.1, No.2

Manufacturer/ Vendor: Taiwan Yuasa Battery Co., Ltd.

Country of Origin: Taiwan

Quantity: Total 2 pieces

Testing Period: Mar. 5, 2018 to Mar. 8, 2018

We have tested the submitted sample(s) as requested and the following results were obtained:

Test Required: Special Provision 238 in International Maritime Dangerous Goods Code 2016

Edition.(Amdt 38-16)

Conclusion

Submittals samples comply with the requirement of Special Provision 238 in International Maritime Dangerous Goods Code 2016 Edition. (Amdt 38-16)

> Signed for and on behalf of SGS TAIWAN Ltd.

Norman Wu Asst. Manager

Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 90 days only. This test report cannot be reproduced, except in full, without prior written permission of the Company. 除非另有說明,此報告結果僅對測試之樣品負責,同時此樣品僅保留 90 天。本報告未經本公司書面許可,不可部份複製。 This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at www.sus.com/terms and conditions.htm and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at www.sus.com/terms e-document.htm, Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

No.31, No.33, No.35, Wu Chyuan Road, New Taipei Industrial Park, Wuku District, New Taipei City, Taiwan/新北市五股區新北產業園區五權路 31 號, 33 號, 35 號

SGS Taiwan Ltd. 台灣檢驗科技股份有限公司

No.134, Wu Kung Road, New Taipei Industrial Park, Wuku District, New Taipei City, Taiwan/新北市五股區新北產業園區五工路 134 號 t (886-2) 2299-3279



Reliability Laboratory

Report No.: HE20031/2018

Page: 2 5 of

Lab Environmental Conditions:


 (20 ± 5) °C Ambient temperature:

 (55 ± 20) % RH Ambient humidity:

Test Equipment:

Name	Brand	Model	Serial No.
Vibration Test System	KingDesign	KD-9363-EM-5000F2K-75N600	WR109237101
Controller	Crystal	spider	1001664
Control Accelerometer	WR	793-6	A4632
Vacuum-Temperature Cabinet	YEONG SHIN	DOBL-45	YSCB940280E
Programmable Temperature & Humidity Chamber	KSON	KSON	VTH-D4T-100

Images:

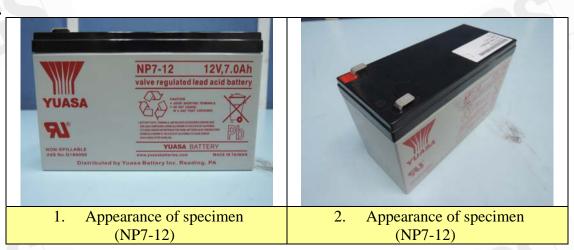

Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 90 days only. This test report cannot be reproduced, except in full, without prior written permission of the Company. 除非另有說明,此報告結果僅對測試之樣品負責,同時此樣品僅保留 90 天。本報告未經本公司書面許可,不可部份複製。
This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at www.sgs.com/terms and conditions.htm and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at www.sgs.com/terms e-document.htm, Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

SGS Taiwan Ltd.

No.31, No.33, No.35, Wu Chyuan Road, New Taipei Industrial Park, Wuku District, New Taipei City, Taiwan/新北市五股區新北產業園區五權路 31 號, 33 號, 35 號 No.134, Wu Kung Road, New Taipei Industrial Park, Wuku District, New Taipei City, Taiwan/新北市五股區新北產業園區五工路 134 號



Reliability Laboratory

Report No.: HE20031/2018

Page: 3 5 of

Images--Continued:





3. Vibration Test Pressure Differential Test



High Temperature Test

Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 90 days only. This test report cannot be reproduced, except in full, without prior written permission of the Company. 除非另有說明,此報告結果僅對測試之樣品負責,同時此樣品僅保留 90 天。本報告未經本公司書面許可,不可部份複製。
This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at www.sgs.com/terms and conditions, htm and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at www.sgs.com/terms e-document.htm, Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

SGS Taiwan Ltd.

No.31, No.33, No.35, Wu Chyuan Road, New Taipei Industrial Park, Wuku District, New Taipei City, Taiwan/新北市五股區新北產業園區五權路 31 號, 33 號, 35 號 No.134, Wu Kung Road, New Taipei Industrial Park, Wuku District, New Taipei City, Taiwan/新北市五股區新北產業園區五工路 134 號 t (886-2) 2299-3279 f (886-2) 2299-9558



Reliability Laboratory

Report No.: HE20031/2018

Page: of 5

Test Method/ Specification:

Special Provisions 238

Test method:

1. Batteries can be considered as non-spillable provided that they are capable of withstanding the vibration and pressure differential tests given without leakage of battery fluid:

Vibration test: The battery is rigidly clamped to the platform of a vibration machine and a simple harmonic motion having an amplitude of 0.8 mm (1.6 mm maximum total excursion) is applied. The frequency is varied at the rate of 1 Hz/min between the limits of 10 Hz to 55 Hz. The entire range of frequencies and return is traversed in 95 ± 5 minutes for each mounting position (direction of vibrator) of the battery. The battery is tested in three mutually perpendicular positions (to include testing with fill openings and vents, if any, in an inverted position) for equal time periods.

Pressure differential test: Following the vibration test, the battery is stored for six hours at 24°C±4°C while subjected to pressure differential of at least 88 kPa. The battery is tested in three mutually perpendicular positions (to include testing with fill openings and vents, if any, in an inverted position) for at least six hours in each position.

Non-spillable type batteries which are an integral part of and necessary for the operation of mechanical or electronic equipment shall be securely fastened in the battery holder on the equipment and protected in such a manner as to prevent damage and short circuits.

2. Non-spillable batteries are not subject to the provisions of this Code if, at a temperature of 55°C, the electrolyte will not flow from a ruptured or cracked case and there is no free liquid to flow and if, when packaged for transport, the terminals are protected from short circuit.

Requirement:

No leakage of battery fluid

Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 90 days only. This test report cannot be reproduced, except in full, without prior written permission of the Company. 除非另有說明,此報告結果僅對測試之樣品負責,同時此樣品僅保留 90 天。本報告未經本公司書面許可,不可部份複製。
This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at www.sgs.com/terms and conditions for Electronic Documents at www.sgs.com/terms e-document, htm. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's sindings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

SGS Taiwan Ltd.

No.31, No.33, No.35, Wu Chyuan Road, New Taipei Industrial Park, Wuku District, New Taipei City, Taiwan/新北市五股區新北產業園區五權路 31 號, 33 號, 35 號 No.134, Wu Kung Road, New Taipei Industrial Park, Wuku District, New Taipei City, Taiwan/新北市五股區新北產業園區五工路 134 號



Reliability Laboratory

Report No.: HE20031/2018

Page: 5 of 5

Test Result:

1. Vibration Test:

Check Item Style/Item No.	Appearance check (Visual check)	
NP7-12/ No.1	No leakage of battery fluid	
NP7-12/ No.2	No leakage of battery fluid	

2. Pressure Different Test:

Check Item Style/Item No.	Appearance check (Visual check)	
NP7-12/ No.1	No leakage of battery fluid	
NP7-12/ No.2	No leakage of battery fluid	

3. High Temperature Test:

Check Item Style/Item No.	Appearance check (Visual check)	
NP7-12/ No.1	No leakage of battery fluid	
NP7-12/ No.2	No leakage of battery fluid	

Test Summary:

Test Item	Test Result	Note
Special Provision 238	Pass	

The End of Test Report

Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 90 days only. This test report cannot be reproduced, except in full, without prior written permission of the Company. 除非另有說明,此報告結果僅對測試之樣品負責,同時此樣品僅保留 90 天。本報告未經本公司書面許可,不可部份複製。
This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at www.sgs.com/terms and conditions.htm and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at www.sgs.com/terms e-document.htm, Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

SGS Taiwan Ltd.

No.31, No.35, Wu Chyuan Road, New Taipei Industrial Park, Wuku District, New Taipei City, Taiwan/新北市五股區新北產業園區五權路 31 號, 33 號, 35 號 No.134, Wu Kung Road, New Taipei Industrial Park, Wuku District, New Taipei City, Taiwan/新北市五股區新北產業園區五工路 134 號